

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 03/14/2012  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE
K0000	<p>A Life Safety Code Recertification and State Licensure Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.70(a).</p> <p>Survey Date: 02/23/12</p> <p>Facility Number: 000074 Provider Number: 155154 AIM Number: 100290050</p> <p>Surveyor: Mark Caraher, Life Safety Code Specialist</p> <p>At this Life Safety Code survey, Spring Mill Meadows was found not in compliance with Requirements for Participation in Medicare/Medicaid, 42 CFR Subpart 483.70(a), Life Safety from Fire and the 2000 edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 19, Existing Health Care Occupancies and 410 IAC 16.2.</p> <p>This two story facility with a basement was determined to be of Type II (000) construction and fully sprinklered. The facility has a fire alarm system with smoke detection in the corridors and in all areas open to the corridor. Smoke detectors were not provided in any</p>			K0000	<p>Please accept this 2567 Plan of Correction for the Life Safety Survey ending February 23, 2012 as the Provider's Letter of Credible Allegation. This Provider respectfully requests consideration for paper compliance in lieu of a revisit survey for this Plan of Correction with a completion date of March 19, 2012.</p>		

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Any deficiency statement ending with an asterisk (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 03/14/2012  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE	
	<p>resident rooms. The facility has a capacity of 142 and had a census of 110 at the time of this survey.</p> <p>Quality Review by Robert Booher, Life Safety Code Specialist-Medical Surveyor on 02/29/12.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p>						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE	
K0038 SS=E	<p>NFPA 101 LIFE SAFETY CODE STANDARD Exit access is arranged so that exits are readily accessible at all times in accordance with section 7.1. 19.2.1</p> <p>Based on observations and interview, the facility failed to ensure 3 of 9 exit door electromagnetic locks remained unlocked while the fire alarm was activated. LSC 19.2.1 requires every aisle, passageway, corridor, exit discharge, exit location, and access to be in accordance with Chapter 7. LSC 7.2.1.6(a) requires doors with special locking arrangements such as electromagnetic locks to unlock upon actuation of an approved fire alarm system installed in accordance with LSC 9.6. LSC 9.6.1.4 requires a fire alarm system to be installed, tested and maintained in accordance with NFPA 72, the National Fire Alarm Code. NFPA 72, 3-9.7.2 requires all emergency exits connected to the fire alarm system unlock upon receipt of any fire alarm signal by the fire alarm system serving the protected premises. This deficient practice affects any residents, staff and visitors needing to exit the facility from the second floor.</p> <p>Findings include:</p> <p>Based on observations with the Maintenance Director during a tour of the facility from 11:15 a.m. to 2:20 a.m. on</p>		K0038	<p><b>F K0038 Exit access is arranged so that exits are readily accessible at all times in accordance with section 7.1 19.2.1 What corrective action(s) will be accomplished for those residents found to have been affected by the deficient practice? All residents have the potential to be affected. A licensed contractor will be hired to rewire the magnetic lock system to be activated by a mechanism that cannot be silenced and thus during alarming, the door will continue to provide egress even when the sound circuitry is disengaged. The magnetic lock will reactivate when the alarm system is returned to normal status and the issue is completely resolved. How will you identify other residents having the potential to be affected by the same deficient practice and what corrective action will be taken? All residents have the potential to be affected. A licensed contractor will be hired to rewire the magnetic lock system to be activated by a mechanism that cannot be silenced and thus during alarming, the door will continue to provide egress even when the sound circuitry is</b></p>		03/19/2012	

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 03/14/2012  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE
	<p>02/23/12, the electromagnetic locks on all exits released and unlocked when the fire alarm was activated at 1:38 p.m., but when the fire alarm was silenced, but not reset, the three second floor exit doors' electromagnetic locks reenergized and locked the exit doors. Based on interview at the time of the observations, the Maintenance Director acknowledged the three second floor exit doors' electromagnetic locks reenergized and locked the second floor exit doors when the fire alarm was silenced but not reset.</p> <p>3.1-19(b)</p>				<p>disengaged. The magnetic lock will reactivate when the alarm system is returned to normal status and the issue is completely resolved. <b>What measures will be put into place or what systemic changes will you make to ensure that the deficient practice does not recur?</b> All exit doors will be checked for the same deficiency. Licensed contractor and Maintenance Director will ensure the rewiring occurs at the main panel which services all exit doors. Furthermore, Maintenance Director or designee will audit monthly to ensure continued function. <b>How will the corrective action(s) be monitored to ensure the deficient practice will not recur, i.e., what quality assurance program will be put into place?</b> Maintenance Director or designee will report any deficiencies found on monthly audit to monthly QAA committee for review and ensure corrective action takes place immediately.</p>		

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE
K0048 SS=E	<p>NFPA 101 LIFE SAFETY CODE STANDARD There is a written plan for the protection of all patients and for their evacuation in the event of an emergency. 19.7.1.1</p> <p>Based on record review and interview, the facility failed to include the use of kitchen fire extinguishers in 1 of 1 written fire safety plans for the facility. LSC 19.7.2.2 requires written health care occupancy fire safety plans shall provide for the following:</p> <ol style="list-style-type: none"> <li>(1) Use of alarms</li> <li>(2) Transmission of alarm to the fire department</li> <li>(3) Response to alarms</li> <li>(4) Isolation of fire</li> <li>(5) Evacuation of immediate area</li> <li>(6) Evacuation of smoke compartment</li> <li>(7) Preparation of floors and building for evacuation</li> <li>(8) Extinguishment of fire</li> </ol> <p>This deficient practice affects any residents, staff and visitors in the vicinity of the kitchen.</p> <p>Findings include:</p> <p>Based on a review of the facility's written fire safety plan titled "Fire Prevention" during record review with the Maintenance Director from 9:20 a.m. to 11:15 a.m. on 02/23/12, the fire safety plan did not address the use of ABC type fire extinguishers and the K class fire</p>			K0048	<p><b>F K0048 There is a written plan for the protection of all patients and for their evacuation in the event of an emergency. 19.7.1.1 What corrective action(s) will be accomplished for those residents found to have been affected by the deficient practice?</b> All residents have the potential to be affected. The Disaster Plan Manual onsite will be updated to include proper procedures for extinguishing any stove fires. The procedures in the manual will state: Instructions for K-Class extinguishers: In case of an appliance fire, actuate the appliance hood fire suppression system prior to using the K-Class extinguisher or any other extinguisher. <b>How will you identify other residents having the potential to be affected by the same deficient practice and what corrective action will be taken?</b> All residents have the potential to be affected. The Disaster Plan Manual onsite will be updated to include proper procedures for extinguishing any stove fires. The procedures in the manual will state: Instructions for K-Class extinguishers: In case of an appliance fire, actuate the appliance hood fire</p>		03/19/2012

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE
	<p>extinguisher located in the kitchen in relationship with the use of the kitchen overhead extinguishing system. Based on interview at the time of record review, the Maintenance Director acknowledged the written fire safety plan for the facility did not include kitchen staff training to activate the overhead hood extinguishing system to suppress a fire before using either the ABC type fire extinguisher or the K class fire extinguisher.</p> <p>3.1-19(b)</p>				<p>suppression system prior to using the K-Class extinguisher or any other extinguisher. Additionally, all manuals in the building will be located and updated with this change. <b>What measures will be put into place or what systemic changes will you make to ensure that the deficient practice does not recur?</b> Staff will be in-serviced on locations of Disaster Plan Manuals and also the procedure involving an appliance fire as it pertains to utilizing suppression hood first. <b>How will the corrective action(s) be monitored to ensure the deficient practice will not recur, i.e., what quality assurance program will be put into place?</b> Executive Director and Maintenance Director or designee will review the Disaster Plan Manual annually and check it for appropriate updates. The Executive Director will then sign off on the manual.</p>		

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE	
K0062 SS=C	<p>NFPA 101 LIFE SAFETY CODE STANDARD Required automatic sprinkler systems are continuously maintained in reliable operating condition and are inspected and tested periodically. 19.7.6, 4.6.12, NFPA 13, NFPA 25, 9.7.5</p> <p>Based on record review and interview, the facility failed to ensure 2 of 2 private fire hydrants were continuously maintained in reliable operating condition and inspected and tested periodically. NFPA 25, 1998 Edition, the Standard for the Inspection, Testing, and Maintenance of Water-Based Fire Protection Systems at Section 4-2.2.4 requires dry barrel hydrants to be inspected annually and after each operation. Hydrants shall be inspected, and the necessary corrective action shall be taken. This deficient practice affects all occupants in the facility including staff, visitors and residents.</p> <p>Findings include:</p> <p>Based on review of SafeCare "Fire Hydrant Testing" documentation dated 10/12/10 with the Maintenance Director during record review from 9:20 a.m. to 11:15 a.m. on 02/23/12, an inspection of the facility's two fire hydrants was not performed within the last twelve months. Based on interview at the time of record review, the Maintenance Director stated no other fire hydrant inspection</p>		K0062	<p><b>F K0062 Required automatic sprinkler systems are continuously maintained in reliable operating condition and are inspected and tested periodically. 19.7.6, 4.6.12, NFPA 13, NFPA 25, 9.7.5 What corrective action(s) will be accomplished for those residents found to have been affected by the deficient practice?</b> All residents have the potential to be affected. A licensed contractor will be retained to perform hydrant run-off tests on the two fire hydrants located on property.</p> <p><b>How will you identify other residents having the potential to be affected by the same deficient practice and what corrective action will be taken?</b> All residents have the potential to be affected. A licensed contractor will be retained to perform hydrant run-off tests on the two fire hydrants located on property.</p> <p><b>What measures will be put into place or what systemic changes will you make to ensure that the deficient practice does not recur?</b> Contract will be initiated and</p>		03/19/2012	

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 03/14/2012  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE	
	documentation was available for review and acknowledged it has been more than twelve months since the last annual inspection of the facility's two fire hydrants.  3.1-19(b)			signed to have this service done automatically every year by a licensed contractor. <b>How will the corrective action(s) be monitored to ensure the deficient practice will not recur, i.e., what quality assurance program will be put into place?</b> Maintenance Director or designee will review internal Life Safety binder which holds all annual and quarterly safety inspections to ensure compliance annually.			



STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE
K0144 SS=F	<p>NFPA 101 LIFE SAFETY CODE STANDARD Generators are inspected weekly and exercised under load for 30 minutes per month in accordance with NFPA 99. 3.4.4.1.</p> <p>1. Based on record review and interview, the facility failed to ensure monthly load testing for the emergency generator was conducted for 5 of 12 months using one of the three following methods: under operating temperature conditions, at not less than 30% of the Emergency Power Supply (EPS) nameplate rating, or loading that maintains the minimum exhaust gas temperatures as recommended by the manufacturer. Chapter 3-4.4.1.1 of NFPA 99 requires monthly testing of generators serving the emergency electrical system to be in accordance with NFPA 110. Chapter 6-4.2 of NFPA 110 requires generator sets in Level 1 and Level 2 service to be exercised at least once monthly, for a minimum of 30 minutes, using one of the following methods:</p> <p>a. Under operating temperature conditions or at not less than 30 percent of the EPS nameplate rating.</p> <p>b. Loading that maintains the minimum exhaust gas temperatures as recommended by the manufacturer.</p> <p>The date and time of day for required testing shall be decided by the owner, based on facility operations. NFPA 99, 3-5.4.2 requires a written record of</p>			K0144	<p><b>F K0144 Generators are inspected weekly and exercised under load for 30 minutes per month in accordance with NFPA 99. 3.4.4.1 What corrective action(s) will be accomplished for those residents found to have been affected by the deficient practice? All residents have the potential to be affected.</b></p> <p>1.The number being used to figure 30% of stand-by rating during load test of emergency generator will be replaced in the monthly load test log to reflect the accurate capacity. This newly corrected number is 13.5 kW. In doing this, more load will be added during testing to support the 30% stand-by rating.</p> <p>2.Maintenance Director or designee will ensure testing of electrolyte levels in generator stand-by battery are completed monthly and documented appropriately when test is completed.</p> <p><b>How will you identify other residents having the potential to be affected by the same deficient practice and what corrective action will be taken?</b></p> <p>All residents have the potential</p>		03/19/2012

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
	<p>inspection, performance, exercising period and repairs shall be regularly maintained and available for inspection by the authority having jurisdiction. This deficient practice could affect all residents, staff and visitors.</p> <p>Findings include:</p> <p>Based on review of "Emergency Generator-Weekly Exercise/Monthly Load Test Log" documentation with the Maintenance Director during record review from 9:20 a.m. to 11:15 a.m. on 02/23/12, monthly load testing for the period of 08/02/11 through 12/06/11 was documented at less than 30% of the Emergency Power Supply (EPS) nameplate rating with no exhaust gas temperatures recorded. Based on interview at the time of observation, the Maintenance Director acknowledged monthly load testing for the period of 08/02/11 through 12/06/11 was documented at less than 30% of the Emergency Power Supply (EPS) nameplate rating with no exhaust gas temperatures recorded.</p> <p>3.1-19(b)</p> <p>2. Based on record review and interview, the facility failed to ensure a complete written record of weekly inspections of</p>		<p>to be affected.</p> <p>1. The number being used to figure 30% of stand-by rating during load test of emergency generator will be replaced in the monthly load test log to reflect the accurate capacity. This newly corrected number is 13.5 kW. In doing this, more load will be added during testing to support the 30% stand-by rating.</p> <p>2. Maintenance Director or designee will ensure testing of electrolyte levels in generator stand-by battery are completed monthly and documented appropriately when test is completed.</p> <p><b>What measures will be put into place or what systemic changes will you make to ensure that the deficient practice does not recur?</b> Maintenance Director or designee will submit the monthly log of generator battery testing to Executive Director for verification of proper testing and documentation. <b>How will the corrective action(s) be monitored to ensure the deficient practice will not recur, i.e., what quality assurance program will be put into place?</b> Maintenance Director or designee will submit the monthly log of generator battery testing to Executive Director for verification of proper testing and documentation. Any missed tests, improper documentation, or deficiencies found on testing will</p>				

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE
	<p>the starting batteries for the emergency generator was maintained for 15 of 52 weeks. Chapter 3-4.4.1.3 of NFPA 99 requires storage batteries used in connection with essential electrical systems shall be inspected at intervals of not more than 7 days and shall be maintained in full compliance with manufacturer's specifications. Defective batteries shall be repaired or replaced immediately upon discovery of defects. Furthermore, NFPA 110, 6-3.6 requires checking storage batteries, including electrolyte levels, at intervals of not more than 7 days. Chapter 3-5.4.2 of NFPA 99 requires a written record of inspection, performance, exercising period, and repairs for the generator to be regularly maintained and available by the authority having jurisdiction. This deficient practice could affect all residents, staff and visitors.</p> <p>Findings include:</p> <p>Based on review of "Emergency Generator-Weekly Inspection Checklist" documentation with the Maintenance Director during record review from 9:20 a.m. to 11:15 a.m. on 02/23/12, weekly emergency generator starting battery inspection records for the fourteen week period from 03/01/11 through 05/31/11 and the week of 01/31/12 was not</p>				<p>be immediately corrected and brought to monthly QAA committee meeting.</p>		

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 03/14/2012  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE
	<p>recorded. Based on interview at the time of record review, the Maintenance Director acknowledged weekly emergency generator starting battery inspection records for the fourteen week period from 03/01/11 through 05/31/11 and the week of 01/31/12 was not recorded.</p> <p>3.1-19(b)</p>						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE	
K0147 SS=E	<p>NFPA 101 LIFE SAFETY CODE STANDARD Electrical wiring and equipment is in accordance with NFPA 70, National Electrical Code. 9.1.2</p> <p>Based on observation and interview, the facility failed to ensure 1 of 1 extension cords including power strips were not used as a substitute for fixed wiring. NFPA 70, Article 400-8 requires, unless specifically permitted, flexible cords and cables shall not be used as a substitute for fixed wiring of a structure. This deficient practice could affect any resident, staff or visitor in the vicinity of the Unit Manager's office on the second floor.</p> <p>Findings include:</p> <p>Based on observation with the Maintenance Director during a tour of the facility from 11:15 a.m. to 2:20 p.m. on 02/23/12, a refrigerator was plugged into a power strip in the Unit Manager's office on the second floor. Based on interview at the time of observation, the Maintenance Director acknowledged a refrigerator was plugged into a power strip in the Unit Manager's office on the second floor.</p> <p>3.1-19(b)</p>		K0147	<p><b>F K0147 Electrical wiring and equipment is in accordance with NFPA 70, National Electrical Code. 9.1.2 What corrective action(s) will be accomplished for those residents found to have been affected by the deficient practice? All residents have the potential to be affected. Maintenance Director will remove refrigerator plug in the Unit Manager's office on second floor from power strip and replace it with a longer cord so it can be plugged directly into wall outlet. Power strip will be removed from Unit Manager's office. How will you identify other residents having the potential to be affected by the same deficient practice and what corrective action will be taken? All residents have the potential to be affected. Maintenance Director will remove refrigerator plug in the Unit Manager's office on second floor from power strip and replace it with a longer cord so it can be plugged directly into wall outlet. Power strip will be removed from Unit Manager's office. What measures will be put into place or what systemic changes will you make to ensure that the deficient practice does not</b></p>		03/19/2012	

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 03/14/2012  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  155154		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/23/2012	
NAME OF PROVIDER OR SUPPLIER  SPRING MILL MEADOWS				STREET ADDRESS, CITY, STATE, ZIP CODE 2140 W 86TH ST INDIANAPOLIS, IN 46260			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE	
				<p><b>recur?</b> Maintenance Director or designee will perform an audit of all higher amperage refrigerators in the building to ensure all are plugged directly into a wall outlet as opposed to a power strip. Corrections will be made as deficiencies are identified. <b>How will the corrective action(s) be monitored to ensure the deficient practice will not recur, i.e., what quality assurance program will be put into place?</b> Maintenance Director or designee with track and trend the usage of these high amperage appliances and inform monthly QAA committee if a trend has been identified and in need of all staff education.</p>			